

Work Order ID 83062

April-12-12 2:22:28 PM

83062

Page 1

Item ID: D212-664-101

Accept

N900040100

Setup

Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Fwd

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/04/12 Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D212-664-141

Rev D (DEO)

100

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D212-664-101 CHG005

110

110

Packaging

Packaging

Pick Kit

Packaging

Memo

0.00

0.00

120

120

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

0.00

0.00

SCRAP

JW

12-6-1

12-6-1

W/O: 83062		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D212-664-101 PAR #: _____ Fault Category: X-tube NCR: Yes No DQA: AK Date: 12/01/07
 Resolution: Seal Disposition: Seal QA: N/C Closed: AK Date: 12/10/07

NCR: 12-1480		WORK ORDER NON-CONFORMANCE (NCR) JTB.63						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
12.06.01	120	Tube overbent. Middle wasn't bent enough. All markings were removed all board due to damage after fire	AK 12/06/07 PSI 042	Width too narrow @ 06.86. Height is +0.51, too high for fwd tube. SCRAP 4P 12.06.07	Rm 12-6-4	JW 12-6-4	AK 12/06/07 PSI 042	reloc 04

NOTE: Date & initial all entries

Work Order ID 83062***83062***

Page 2

April-12-12 2:22:28 PM

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130 QC15- Crosstube Dimensional Check

0.00

130

QC Memo

0.00

Quality Control

140

0.00

140

Crosstubes

Crosstubes Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83062***83062***

Page 3

April-12-12 2:22:28 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Fwd

Stop

NS2

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

150

Crosstubes Chemical Conversion

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Chemical Conversion Coat within 24 hours of bending and drilling

160

QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

Quality Control

170

Outsource process - NDT per QSI038 4.1

0.00

170

Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 038
Issue P/O: _____
LPI as per ASTM 1417 Level 2
Attach copy of NDT results to work order

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83062

April-12-12 2:22:28 PM

83062

Page 4

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	Receive & Inspect for Damage & Mat'l Certs	0.00							
180	Packaging								
Packaging	Memo	0.00							
Packaging	Ensure copy of NDT results attached to work order.								
190	QC5- Inspect part completeness to step on W/O	0.00							
190									
QC	Memo	0.00							
Quality Control	Inspect for damage & ensure results are as per Dwg D212-664-141								

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83062

April-12-12 2:22:28 PM

83062

Page 5

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

Spray Painting per QSI005 4.2

0.00

200

SprayPaint

0.00

SprayPaint

Memo

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube as per DEO D212-667-141 with White Imron as per QSI 005 4.2

PRIME:

Start Time: _____

Finish Time: _____

PAINT:

Start Time: _____

Finish Time: _____

210

QC14- Inspect Spray Paint

0.00

210

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

83062

Page 6

N900040100

Setup Start *NS1*

Stop ***NS2***

Start Date: 12/04/2012 **Start Qty:** 1.00 ***1***

Required Date: 26/04/2012 **Req'd Qty:** 1.00 *** 1 ***

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

[illegible]

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83062

April-12-12 2:22:28 PM

83062

Page 7

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Fwd

Stop ***NS2***

Start Date: 12/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 26/04/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	QC4- 100% Inspect kits for completeness	0.00							
250									
QC	Memo	0.00							
Quality Control									
260		0.00							
260	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D212-664-101								
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.00							
Quality Control									

mf
12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-12-12 2:22:33 PM

Page 1

Work Order ID: 83062

83062

Parent Item: D212-664-101

D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP Rev:E04.02.16ReformatKJ/DS

IPP Rev:F 06-03-29 Remove Coments on Pick List JLM

IPP Rev:G 07-04-30 As per Rev C JLM

IPP Rev:H

11.04.26 inspection strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN		Manufactured	No			110	Each	7.0000	1	1			
D212-664-101TRN				B83089					**			JW 12-6-1	
Crosstube Turning Detail													

Location	Loc Qty	Loc Code
FG046	3	
68584	0	
81140	1	
81141	1	
82577	1	
LG	4	
81812	1	
82574	1	
82575	1	
82576	1	

D3595-063-450

Manufactured No

230

Each

83.8095

4

4.210526

D3595-063-450

**

RUBBER CUSHION

Location	Loc Qty	Loc Code
LG051	73.7	
80161	73.7	
MAT052	10.109474	
67353	2	
68893	6	
70113	0.56	
71354	0.2	
74113	0.349474	
75597	1	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-12-12 2:22:33 PM

Page 2

Work Order ID: 83062

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

83062

D212-664-101

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-25

Purchased

No

220

Each

133.0000

4

4

MS21920-25

Clamp(per MIL-DTL-8783C)

**

Location

Loc Qty

Loc Code

LG050

133

116264

2

117998

4

118142

4

119339

2

119746

2

120475

19

120920

100

D2893-1

Manufactured

No

220

Each

10.0000

2

2

D2893-1

2.75 Support

**

Location

Loc Qty

Loc Code

LG052

10

72865

2

76250

1

82228

7

D3428-1

Manufactured

No

240

Each

31.0000

1

1

D3428-1

Placard

**

Location

Loc Qty

Loc Code

ST042

31

78933

14

81881

17

April-12-12 2:22:33 PM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-12-12 2:22:33 PM

Page 3

Work Order ID: 83062

83062

Parent Item: D212-664-101

D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 12/04/2012

Required Date: 26/04/2012

Start Qty: 1.00

Required Qty: 1.00

AN6-35A

Purchased

No

240

Each

106.0000

4

4

AN6-35A

BOLT

Location

Loc Qty

Loc Code

342

50

121181

50

ST342

56

120187

56

AN6-36A

Purchased

No

240

Each

116.0000

4

4

AN6-36A

Bolt

Location

Loc Qty

Loc Code

ST342

116

118422

2

119449

1

120187

13

120423

100

MS21042L6

Purchased

No

240

Each

790.0000

6

6

MS21042L6

Nut

Location

Loc Qty

Loc Code

ST300

790

117677

25

118384

3

118927

48

119075

514

120308

200

AN960JD616

NAS1149D0663J

Purchased

No

240

Each

0.0000

18

18

AN960JD616

Washer

April-12-12 2:22:33 PM

Shop Packet Print

Page 3

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	83062
Description: Crosstube High Fwd (205/212/412)	Part Number:	D212-664-101
Inspection Dwg: D212-664-141 Rev: D		Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

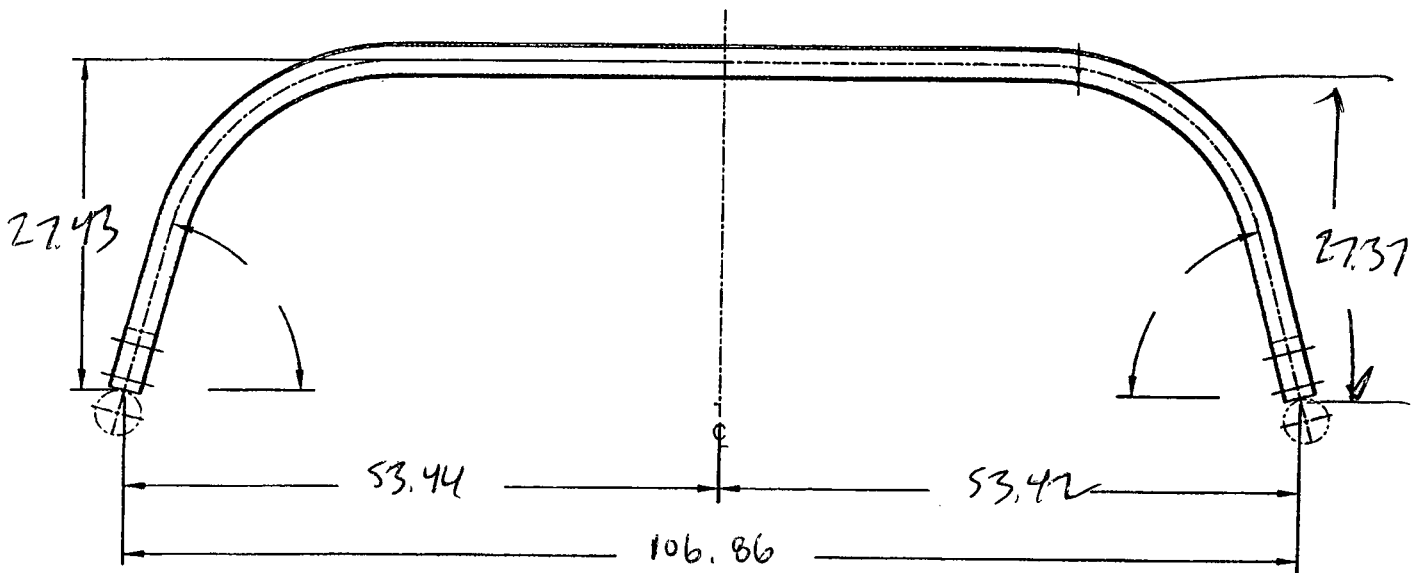

Comments
Too narrow (2107) too high (+0.51).
SCRAP 4/12.06.01

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS
6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE
SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND
MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO.

03062 MJS

12/04/12

REMOVED FROM UNDER REVIEW PCC
UNDER REVIEW EGN# 11-614
11/06/15
FOR PRELIMINARY JUDGES

DEO ATTACHED

RELEASED
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

12 13 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-063-450 RUBBER CUSHION, 2X
2 PL

A4-2

A

14.00 (-141)
OR 13.75 (-141B)



D212-664-501
BENT TUBE

CL
SYM


D212-664-141/-141B
ASSEMBLY DETAIL



620411-614
1.07.20
UNDER REVIEW
11.9.13

DEO ATTACHED

RELEASED
2009-10-29

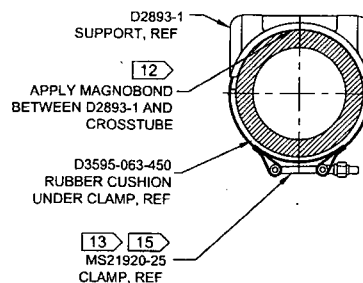

SECTION A-A D5-2
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 2 OF 4
APPROVED	MP	TITLE	SCALE
DE APPR.	TH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

83062

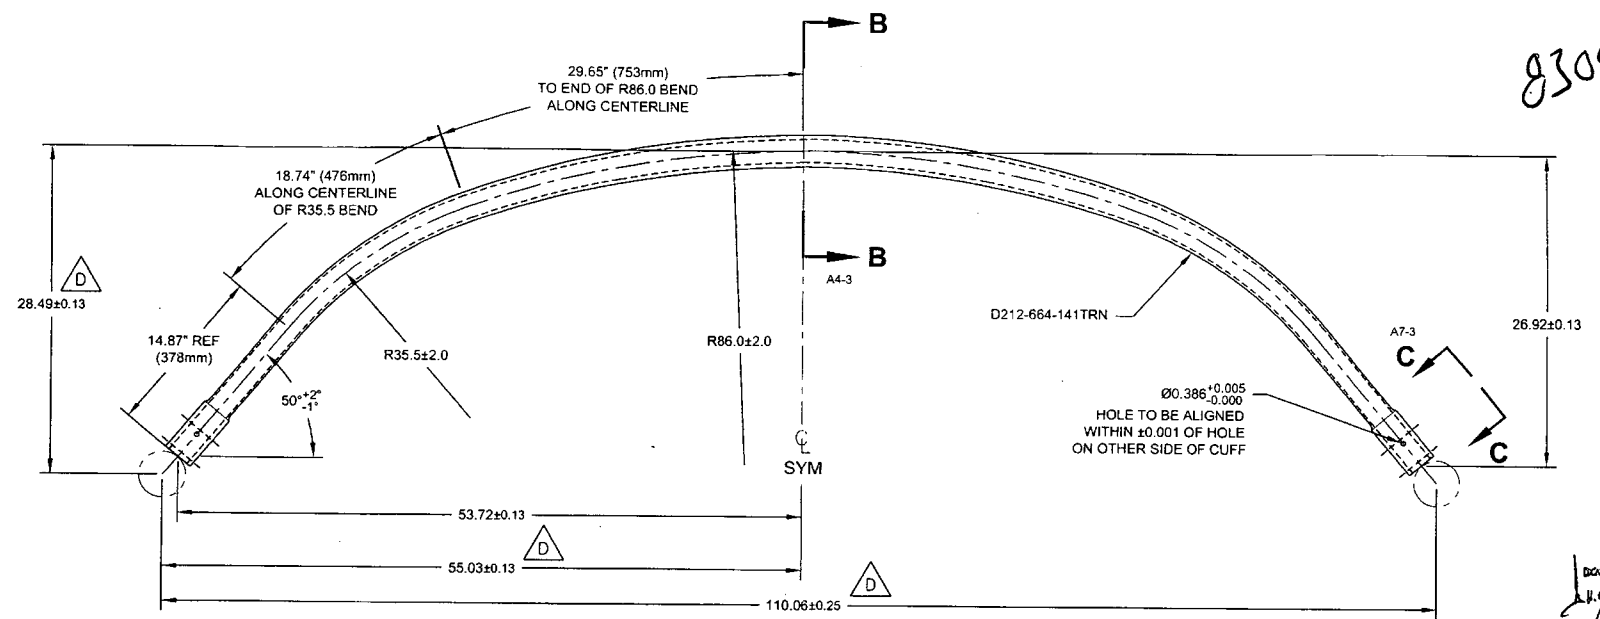


D212-664-501
BENDING AND DRILLING DETAIL

10 D


000711-64
11.09.30
UNDER REVIEW
11.09.30

DEO ATTACHED

RELEASED
2009-10-29

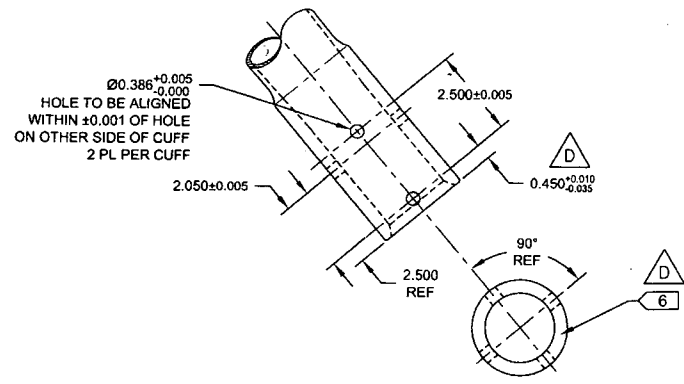

VIEW C-C: CUFF DETAIL
SCALE 3X

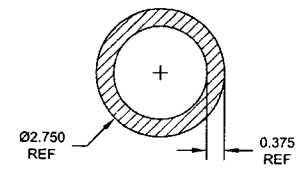

SECTION B-B
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	ST	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

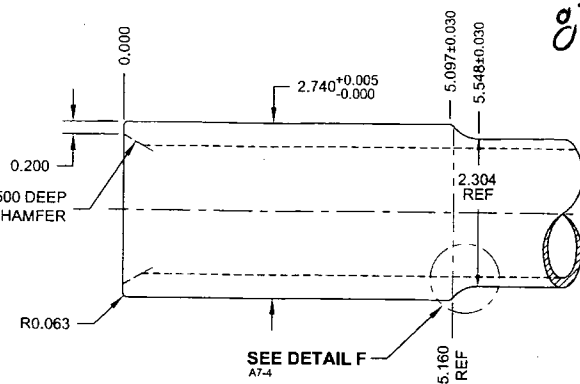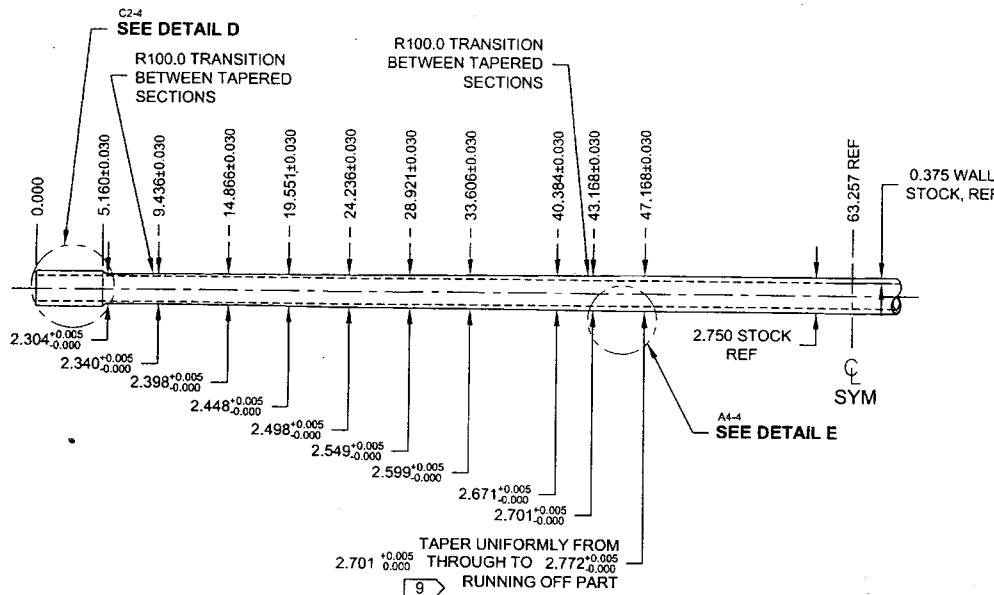


DETAIL D:
CROSSTUBE CUFF D8-4
SCALE 5X

D212-664-141TRN
TURNING DETAIL

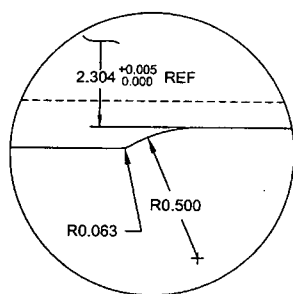

DETAIL F:
CUFF TRANSITION C2-4
SCALE 10X

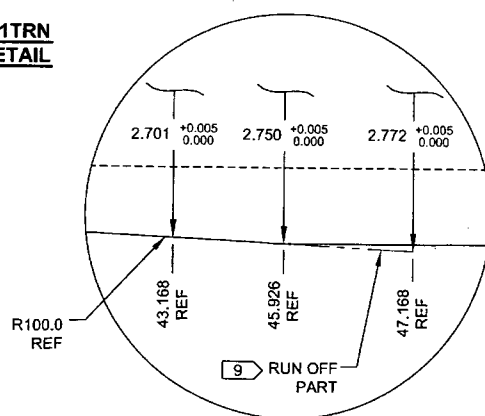

DETAIL E:
TAPER RUN-OFF C5-4
NOT TO SCALE

UNDER REVIEW
11.06.13

DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RP	DRAWING NO.	REV. D
MFG. APPR.	RS	D212-664-141	SHEET 4 OF 4
APPROVED	RP	TITLE	SCALE
DE APPR.	RP	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.	DATE	DATE	DATE
11.04.07	11.04.11	11.04.12	11/04/12	11.04.12	11.04.12	11.04.12	11.04.12

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

14/06.13
12/06.14
11.07.28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>E</i>	APPROVED <i>WAD</i>		DE APPR. <i>WAD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12		DATE 11.04.12		

IS:



WAS:

UNDER REVIEW

4/11/06.13

ECN# 11-614


11.07.28

83062

D212-664-501
BENT TUBE

D212-664-141/-141B
ASSEMBLY DETAIL

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

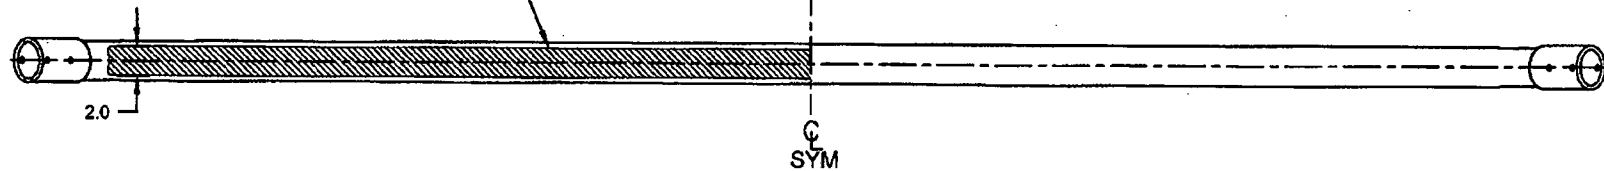

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>MD</i>		DE APPR. <i>TH</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

83062

RELEASED
2011-07-28
MD

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries